Pin 1	DMX–
Pin 2	DMX+
Pin 3	GND

1 Cable OD: Ø3 — 6mm
Strip CAT5 cable (coating remain)



2 Run cable through connector

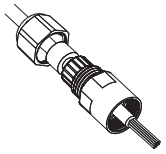

3 Crimp connector onto cable
Tighten Sealing Nut temporary

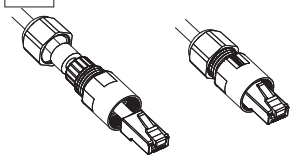

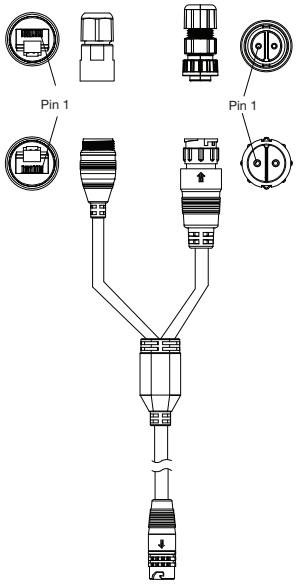

Pin 1	V+
Pin 2	V–

1 Cable OD: Ø8 — 10mm
Conductor: 14 AWG / 2.5mm² max.
Strip cable



2 Run cable through connector
Tightening Torque: 0.6 — 0.8Nm
Tighten cable onto screw terminals

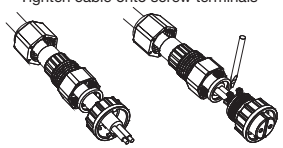

3 Tightening Torque: 0.7 — 0.9Nm
Tighten Clamp Ring

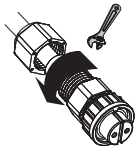

4 Plug RJ45 until “click” sound is heard

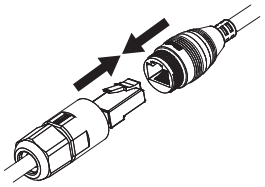

5 Tightening Torque: 0.7 — 0.9Nm
Tighten Clamp Ring

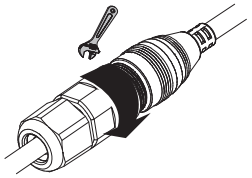

6 Tightening Torque: 0.7 — 0.9Nm
Tighten Sealing Nut

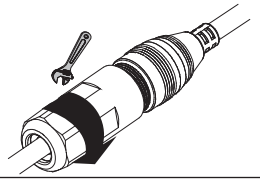

4 Tightening Torque: 0.7 — 0.9Nm
Tighten Sealing Nut

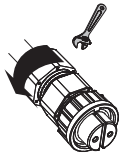

5 Push both connectors onto each other



6 Turn Lock Nut clockwise for half cycle to lock

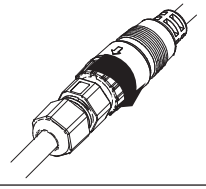

RJ45 / Power Data to Quick Lock Injector Cable Kit Assembly Guide (TU.AC.0600400)

Pin 1	DMX–
Pin 2	DMX+
Pin 3	GND

1 Cable OD: Ø3 — 6mm
Strip CAT5 cable (coating remain)



2 Run cable through connector

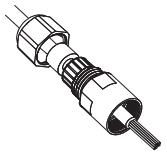

3 Crimp connector onto cable
Tighten Sealing Nut temporary

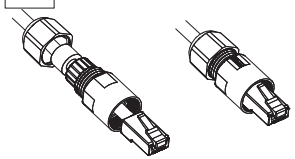

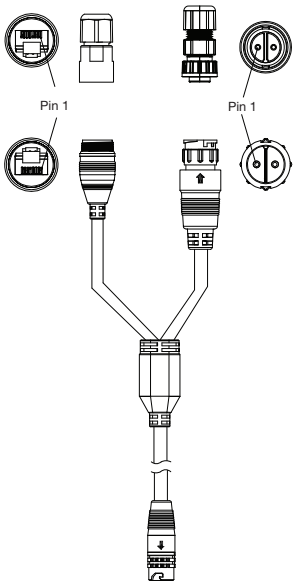

Pin 1	V+
Pin 2	V–

1 Cable OD: Ø8 — 10mm
Conductor: 14 AWG / 2.5mm² max.
Strip cable



2 Run cable through connector
Tightening Torque: 0.6 — 0.8Nm
Tighten cable onto screw terminals

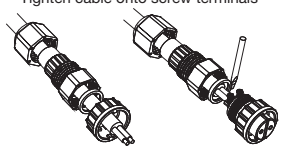

3 Tightening Torque: 0.7 — 0.9Nm
Tighten Clamp Ring

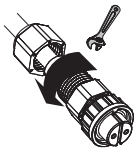

4 Plug RJ45 until “click” sound is heard

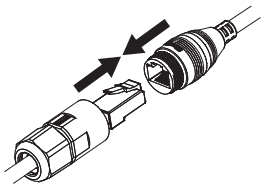

5 Tightening Torque: 0.7 — 0.9Nm
Tighten Clamp Ring

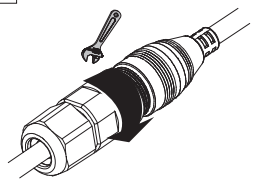

6 Tightening Torque: 0.7 — 0.9Nm
Tighten Sealing Nut

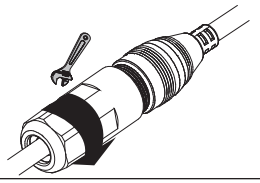

4 Tightening Torque: 0.7 — 0.9Nm
Tighten Sealing Nut

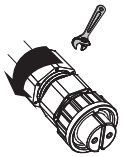

5 Push both connectors onto each other



6 Turn Lock Nut clockwise for half cycle to lock